

FH-1/2-PBT

Part number: 938-6500/C014 (NPN)

Part number: 938-6500/184 (PNP)



TURBINE FLOWMETER FOR LIQUIDS



General Description

The FH Flowmeter is a general-purpose device; specially for higher throughputs of up to approx. 30 I/min. It is employed for measuring, regulating or metering and guarantees most precise measurement of fluid quantities. In addition, a pulse generator integrated into the flowmeter guarantees a practically unlimited useful life.

Special features: Able to withstand high temperatures, good resistance to chemicals. Linear inlet and outlet, compact design.

Approvals / Standards

EN 50081-1:92, EN 50082-1:97, EN 61000-3-2:00, EN 61000-3-3:95, IEC 61000-6-3:96,IEC 61000-6-1:96, IEC 61000-3-2-00,IEC 61000-3-3:94+A1:01



Material:	
Housing:	

Bearing pin:

PBT 35%GF (Arnite) Inox 1.4305 (18/8) Inox 1.4571 on request

0-rina: MVQ (Silikon)

FPM (Viton)/EPDM on request

Turbine:

Magnets: Keramik Sr Fe O

(in contact with the medium)

Screw: PT-screws

(Phillips cross recessed)

Technical data:

3 - 30 I/min Flow rate: Measuring accuracy: \pm /- 2.0% < +/- 0.25% Repetition: -10° C to $+65^{\circ}$ C Temperature range:

14°F to 149°F

20 bar at 20°C Pressure range:

290 psi /68°F

Mounting position: Horizontal recommended

Nozzle size: Ø 10.0 mm

Electrical connection ratings:

4.5-24 VDC Power supply:


5 mA to max.13 mA Consumption: Signal connection: Open collector NPN o PNP

Signal voltage: 0 V GND Signal load: max. 20 mA

Leakage current: max. $10 \mu A$

Connections: 3-pin AMP 2.8 x 0.8 mm Signal: Square-wave output $50\%/\pm5\%$ **Duty Cycle:**

Dimensions in mm:

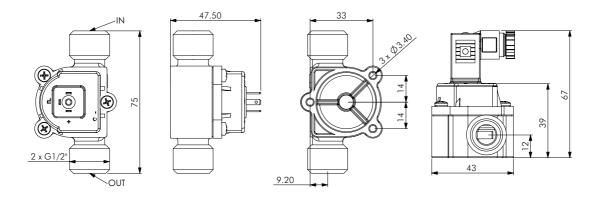


Options: 3-pin solenoid socket Item number: 941-0002/3 We reserve the right to make modifications in the interests of technical progress


Special regulations which must be complied with by the flowmeter manufacturer apply to each country, e.g. CE, NSF, FDA and SK. The various media flowing through the flowmeter differ from application to application. You are advised to enquire with the medium manufacturer as to whether the entire installation and the flowmeter are resistant to the medium itself (see Material)!

- The flowmeter does not supply an output voltage but switches the signal terminal to $\mathbf{0}$ V ground (actuated) or leaves it open (nonactuated)
- There must be a pull-up resistor between power supply + and signal depending on electronic circuitry!



Measurement Curve FH G1/2" 10.00 mm

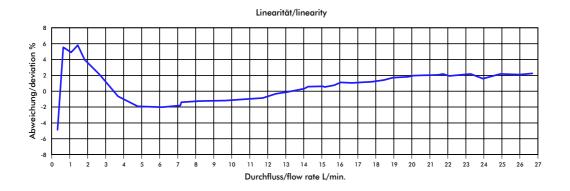

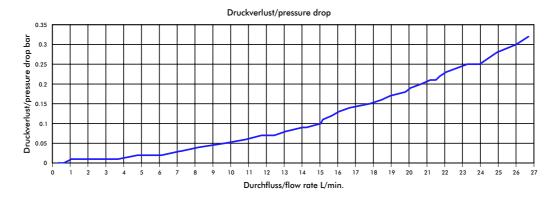

Medium: Water / max. Pressure: 3.3 bar

Nozzle size	Pulses/litre	g/pulse	min. flow rate in litres/min at Linear start	max. flow rate in litres/min	Pressure loss
Ø 10.00 mm	130	15.37	3.00	26.69	0.32

The values specified must be considered as approximate values.

The number of pulses per litre may differ depending on medium and installation. We recommend to calibrate the number of pulses per litre in line with the complete installation.

MEASUREMENT TIPS

- Ensure that there is no fast-pulsatory movement of the media
- Ensure that there are no reverse pressure
- Ensure that there is no air in the system
- · Note the mounting position of the flowmeter
- Min/max flow should be in the linear range of the selected flowmeter
- Clean the system at appropriate intervals
- · Avoid electrical current peaks
- ullet Incorrect cabling of power supply +, signal and ground will destroy the flowmeter
- Do not mechanically load electrical contacts
- Avoid moisture on the electrical contacts
- Avoid stray pick-up via the cable (Do not lay cables in parallel with high current loads)



Spare parts:

